CRITICAL ITEMS LIST

PROJECT: SRMS (-5 MCTU INSTALLED)
ASS'Y NOMERICLATURE: MCTU

SYSTEM: ELECTRICAL SUBSYSTEM
ASS'Y P/R: 51755F160-5 SHEET: 1

| REF. DRAWING REF. CAUSE DO CHIEF OF CHARLES POUR COMOTIONER OF COMOTIO | | FMEA | FMEA | NAME, OFY, & | FAILURE MODE | CALLUDE SECTION | ASS'T P/N: 51155F160-5 SHEET: | <u>_1</u> |
|--|-----------|----------|------|--|---|---|--|-----------|
| POME CONTINUES OF MCPC OTY, 1, SCHEMATICS OTISTA AND CONTINUES OF MCPC OTY, 1, SCHEMATICS OTISTA CAUSE(S) OTISTA CONTINUES OF MCPC OTISTA CONTINUES CONTINUES FAIL OPEN. CONTINUES CONTINUES FAIL OPEN. CONTINUES FAIL | - | REF. | | DRAWING RÉF. | AND | | 3\ inva | |
| PROCESSES. DEVICE STRESS LEVELS ARE, DERATED IN ACCORDANCE WITH SPAR-RMS-PA.003 AND VERIFIED BY DESIGN REVIEW. COMPARATORS AND OPERATIONAL AMPLIFIERS ARE STANDARD LINEAR INTEGRATED CIRCUITS WITH MATURE MANUFACTURING TECHNOLOGY. APPLICATION CONSTRAINTS ARE IN ACCORDANCE WITH SPAR-RMS-PA.003. | | | | POWER COMDITIONER OTY. 1. SCHENATICS 812798 815444 | AND CAUSE MODE: LOSS OF MCPC PROTECTIOM. CAUSE(S): 1) POWER CONTROLLER RESISTORS FAIL OPEN. 2) POWER CONTROLLER DIODES FAIL OPEN. 3) RECTIFIER BOARD DIODES | ON END ITEM NONE MORST CASE LOSS OF MCIU. LOSS OF COMPUTER SUPPORTED MODES. REDUNDANT PATHS REMAINING FOR SAFING THE SYSTEM: 1) MCPC FAILURE DETECTION. | CRITICALITY SCREEMS: A-FAIL, 8-FAIL, C-PASS DESIGN FEATURES EEE PARTS HAVE BEEN SELECTED AND CONTROLLED IN ACCORDANCE WITH SPAR-RMS-PA. 003. IHIS DOCUMENT DEFINES THE PROGRAM REQUIREMENTS FOR MONITORING AND CONTROLLING EEE PARTS. THE REQUIREMENTS FOR MONITORING AND CONTROLLING EEE PARTS. THE REQUIREMENTS INCLUDE PART SELECTION TO A1 LEAST "ESTABLISHED RELFABILITY" LEVELS, AND ADEQUATE OFRATING OF PART STRESS LEVELS. PROCEDURES AND ACTIVITIES ARE SPECIFIED TO RESURE AT LEAST EQUIVALENT QUALITY FOR MONSTANDARD AND IRREGULAR PARTS. HEAST EQUIVALENT QUALITY FOR MONSTANDARD AND IRREGULAR PARTS. HIGH FAILURE RATES. AFROSPACE DESIGN STANDARDS FOR DETAILING ELECTRONIC PARTS PACKAGING, MOUNTING AND STRUCTURAL/MSCHAMICAL/INTEGRITY OF ASSEMBLIES ARE APPLIED. SUCH DESIGN HAS BEEN REVIEWD AND FOUND SATISFACTORY THROUGH THE DESIGN AND IT PROCESS, INCLUDING THE USE OF RELIABILITY, MAINTAINMENT OF SATISFACTORY THROUGH THE DESIGN AND IT PROCESS, INCLUDING THE USE OF RELIABILITY, MAINTAINMENT OF SATISFACTORY THROUGH WAS BEEN REVIEWD AND FOUND SATISFACTORY THROUGH USAGE CONFORMS TO SPAR SO. 360 MICH IS EQUIVALENT TO THE MASSA MAIRTIANS TO SPAR SO. 360 MICH IS EQUIVALENT TO THE MASSA MAIRTIANS TO SPAR SO. 360 MICH IS EQUIVALENT TO THE MASSA MAIRTIANS TO SPAR SO. 360 MICH IS EQUIVALENT TO THE MASSA MAIRTIANS AND EEN COMPLETED AND COMPIREMENTS. MORST CASE ANALYSIS HAS BEEN COMPLETED AND COMPIREMENTS. PRINTED CIRCUIT BOARD DESIGNS HAVE BEEN REVIEWED TO ENSURE ADDEDUATE CIRCUIT PAIN MIDDIN AND SEPARATION AND TO CONFIRM APPROPRIATE DIMENSIONS OF CIRCUIT SOLDER PADS AND OF COMPONENT HOUSE APPROVED MOUNTING METHODS, STRESS RELIEF, AND COMPONENT SECURITY. UNERER APPLICABLE DESIGN DRAWINGS AND DOCUMENTATION GIVE CLEAR JUBRITIFICATION OF HANDLING PRECAUTIONS FOR ESD SENSITIVE PARTS. BOARD ASSEMBLY DRAWINGS INCLUDE THE REQUIREMENTS FOR SOLDERING STANDARDS IN ACCORDANCE WITH NHB 5300.4(3) AND JSC OBBOO. ALL RESISTORS AND CAPACITORS USED IN HEE PESIGN ARE SLEVELS ARE DEFICION TO A COMPONENT CONTROL OF THE MAINTAICHURING PROCESSES. DEVIC | 7, |
| DREDANCE BY. MILE | PREP | ARED BY; | ME M | G . | SUPERCEDING DATE: | HONE | to the company of the company | } |
| DATE: 11 JUL 91 CIL REV: 0 | | | | | | | 3 DAFE: 11 JUL 91 CIL REV: | 0 |

| FHEA | FNEA | HAME, QTY, & | FAILURE MODE | ROJECT: SAMS (-5 MC SS'Y NOMENCLATURE: MI FAILURE EFFECT | | | \$1155F160-5 | SHEET: | <u> </u> | |
|------|------|--|---|---|---------------------------------------|--|----------------------|---------------|-------------|-----------------|
| REF. | REV. | NAME OTY & DRAWING RÉF. DESIGNATION | AND CAUSE | ON END ITEM | HDWR / FUNC. 3/1RAB ERITICALITY | RATIONALE FOR SCREENS: A-FAIL, | | | İ | |
| 2536 | 0 | POMER CONDITIONER DTY. 1. SCHEMATICS B12798 B15444 2559054 | MODE: LOSS OF MCPC PROTECTION. CAUSE(S): 1) POWER CONTROLLER RESISTORS FAIL OPEN. 2) POWER CONTROLLER DIODES FAIL OPEN. 3) RECTIFIER BOARD DIODES FAIL OPEN. | NOME WORST CASE LOSS OF MCIU. LOSS OF MCIU. LOSS OF COMPUTER SUPPORTED MODES. REDUNDANT PATHS REMAINING FOR SAFING THE SYSTEM: 1) MCC FAILURE DETECTION. 2) AUTOBRAKES. | THE DESIGN COMPONENT | OF THIS CIRCUIT ACCOMO AND OPERATING ENVIRONME IED PERFORMANCE REQUIRE | DATES ALL WORST CASE | FIACA PUAT | | |
| | | | | | | | | [[[[]]] | tait Mar | PAGE 466 OF 471 |

RMS/ELEC - 222

CRITICAL ITEMS LIST

PROJECT: SRMS (-5 MCTU INSTALLED)
ASS'Y MOMENCLATURE: MCTU

SYSTEM: ELECTRICAL SUBSYSTEM ASS'Y P/N: 51155F160-5

| FMEA REF. | FMEA REV. | NAME QTY & DRAWING REF. DESIGNATION | FAILURE MODE AND CAUSE | FAILURE EFFECT ON END TIEM | 3/ IRAB | RATIONALE FOR ACCEPTANCE EENS: A-FAIL, B-FAIL, C-PASS | SHEET: | <u>.</u> | |
|--------------|--------------|--|---|---|--|--|------------|----------|---------------------------------------|
| 2536 | | POMER CONDITIONER QTY. 1. SCHEMATICS B12798 B15444 2559054 | MODE: LOSS OF MCPC PROTECTION. CAUSE(S): 1) POWER CONTROLLER RESISTORS FAIL OPEN. 2) POWER COMTROLLER DIGOES FAIL OPEN. 3) RECTIFIER BOARD DIGOES FAIL OPEN. | HONE HORST CASE LOSS OF MCIU. LOSS OF COMPUTER SUPPORTED MODES. REDUNDANT PATHS REMAINING FOR SATING THE SYSTEM: 1) MCPC FAILURE DEVECTION. 2) AUTOBRAKES. | ACCEPTANCE TESTS THE MCTU IS SUBJECTE ENVIRONMENTAL TESTIN O VIBRATION: LEVEL O THERMAL: +40 D OUALIFICATION TESTS THE MCTU IS SUBJECTE ENVIRONMENTS: O VIBRATION: LEVEL O SHOCK: BY SH O THERMAL: +51 DH O HAMIDITY: BY SH O ENC: NIL-S CEO1, RS02 | ED TO THE FOLLOWING ACCEPTANCE | | | |
| PREPARED BY: | . MFI | , MG | SUPERCEDING DAIE: | NOME | | DATE: 11 JUL 91 | CIL REV: n | | SOCO237A ATTACHMENT - PAGE 467 OF 471 |

RMS/ELEC - 223

DATE: 11 JUL 91 CIL REV: 0

PROJECT: SRMS (-5 MCIU INSTALLED)
ASS'Y NOMENCLATURE: MCIU

SYSTEM: ELECTRICAL SUBSYSTEM ASS'Y P/N: 51155F160-5

| c | H | r | c | t | |
|---|---|---|---|---|--|

| | | | | | | MAS 1 1/W. 311331 100 3 SHEET; |
|---|------------|--------------|--|---|--|--|
| | HEA EF. | FNEA REV. | NAME, OTY, & DRAWING REF. DESIGNATION | FAILURE MODE AND | FAILURE EFFECT | HDWR / FUNC. RATIONALE FOR ACCEPTANCE 3/1RAB |
| ļ | 75.74 | | - | CAUSE | END LIEM | CRITICALITY SCREENS: A-FAIL, B-FAIL, C-PASS |
| | 2536 | 0 | POWER COMDITIONER GIV. 1. SCHEMATICS 812798 815444 2559054 | MODE: LOSS OF MCPC PROTECTION. CAUSE(S): 1) POWER CONTROLLER RESISTORS FAIL OPEN. 2) POWER CONTROLLER DICOSE FAIL OPEN. 3) RECTIFIER BOARD DICOSE FAIL OPEN. | HONE LOSS OF MCIU. LOSS OF COMPUTER SUPPORTED MODES. REDUNDANT PATHS REHAINING FOR SAFING THE SYSTEM: 1) MCPC FAILURE DETECTION. 2) AUTOBRAKES. | DOCUMENTED QUALITY CONTROLS ARE EXERCISED THROUGHOUT DESIGN PROCUMENTED QUALITY CONTROLS ARE EXERCISED THROUGHOUT DESIGN PROCUMENT. PLANNING, RECEIVING, PROCESSING FABRICATION, ASSEMBLY, TESTING AND SHIPPING OF THE MCIU. GOVERNMENT SOURCE INSPECTION IS INVOKED AT VARIOUS LEVELS OF COMPONENT ASSEMBLY AND TEST OPERATIONS. MANDATORY INSPECTION POINTS ARE EMPLOYED AT VARIOUS LEVELS OF ASSEMBLY AND TEST. EEE PARTS INSPECTION IS PERFORMED AS REQUIRED BY SPAR RIMS-PA.003. EACH EEE PART IS QUALIFIED AT THE PART LEVEL TO THE REQUIREMENTS OF THE APPLICABLE SPECFFICATION. ALL EEE PARTS ARE 100X SECREMED AND BURNED IN, AS A NINHMAM AS REQUIRED BY SPAR-RIMS-PA.003, BY THE SUPPLIER. ADDITIONALLY, EEE PARTS ARE 100X RE-SCREENED IN ACCORDANCE WITH REQUIREMENTS, BY AN INDEPENDENT SPAR PAPROVED TESTING FACILITY. DPA IS PERFORMED AS REQUIRED BY PA.003 ON A RANDOMLY SELECTED SX OF PARTS, MAINHMA SPIECES, MINIMAM 3 PIECES FOR EACH LOT MUMBER/DATE CODE OF PARTS RECEIVED. MIR. IS PROCURED, INSPECTED, AND TESTED TO SPAR-RIMS-PA.003. RECEIVING INSPECTION VERTIFIES THAT ALL PARTS RECEIVED ARE AS JOENTIFIED IN THE PROCUREMENT DOCUMENTS, THAT NO PRYSICAL DAWAGE HAS OCCURRED TO PARTS DUTING SHIPPMIT, THAT THE RECEIVING DOCUMENTS PROVIDE ADEQUATE TRACEABILITY INFORMATION AND SCREENING DATA CLEARLY IDENTIFIES ADECIPABLE PARTS. PARTS ARE INSPECTED THROUGHOUT MANUFACTURE AND ASSEMBLY AS APPROPRIATE TO THE MANUFACTURING STAGE COMPLETED. THESE THAT ALL PARTS RECEIVED AND ADEQUACY OF PLATED THROUGH HOLES, COMPONENT MOUNTING INSPECTION FOR ADEQUATE PROCESSING IS PREFORMED USING DATA CLEARLY IDENTIFIES AND ADEQUACY OF PLATED THROUGH HOLES, COMPONENT MOUNTING INSPECTION FOR ADEQUATE PROCESSING IS PREFORMED USING ULTRAVIOLET LIGHT TECHNIQUES. POST P.C. BD. INSTALLATION INSPECTION, CHECK FOR CORRECT BOARD INSTALLATION ALIGNMENT OF BOARDS, PROPER CONNECTOR CONTACT MATTING, MIRE ROUTING, STRAPPING OF WIRES ETC., PRE-ACCEPTANCE IEST INSPECTION, MORKMANSHIP AND CLEANLINESS AND LONGERANGENT FOR FOUNT OF THE PART HOW VERTIFICATION TO AS DESIGN ETC., |

SD40237A ATTACHMENT -PAGE 468 DF 471

PREPARED BY:

SUPERCEDING DATE: NONE RMS/ELEC - 224

DATE: 11 JUL 91

CIL REV: 0

CRITICAL ITEMS LIST

PREPARED BY:

MING

PROJECT: SAMS (-5 MCIU INSTALLED)
ASS'Y NOMENCLAYURE: MCIU

SYSTEM: ELECTRICAL SUBSYSTEM
ASS'Y P/R: 511557160-5

DATE: 11 JUL 91

Cli REV: 0

SHEET:

| FMEA REF. | FMEA REV. | NAME, GTY, & DRAWING REF. DESIGNATION | FAILURE MODE AND CAUSE | FAILURE EFFECT ON END LIEN | HDWR / FUNC. RATIONALE FOR ACCEPTANCE 3/1RAB CRITICALITY SCREENS: A-FAIL, 8-FAIL, C-PASS |
|--------------|--------------|---|--|--|--|
| 2536 | 0 | DESIGNATION POWER CONDITIONER QTY. 1. SCHEMATICS 812798 815444 2559054 | CAUSE MODE: LOSS OF MCPC PROTECTION. CAUSE(S): 1) POWER CONTROLLER RESISTORS FAIL OPEN. 2) POWER COMTROLLER DIODES FAIL OPEN. 3) RECTIFIER BOARD DIODES FAIL OPEN. | END ITEM MORST CASE LOSS OF HCIU. LOSS OF COMPUTER SUPPORTED MODES. REDUNDANT PATHS REMAINING FOR SAFING THE SYSTEM: 1) MCPC FAILURE DETECTION. 2) AUTOBRAKES. | |
| | | | | | |

SO40237A ATTACHMENT -PAGE 469 OF 471

- 1 RMS/ELEC - 225

SUPERCEDING DATE: NONE

| FMEA | FHEA | NAME OTT | FAILURE NODE | ROJECT: SRMS (S MC SS'Y NOMENCLATURE: MI FAILURE EFFECT | | | : <u>51155F160-5</u> | SHEET: 6 | : |
|------|------|--|---|--|---------------------------------------|-----------------------------------|-------------------------|----------|-----------------|
| REF. | REV. | NAME OTY A DRAWING RÉF. DESIGNATION | AND CAUSE | ON END ITEM | HOWR / FUNC. 3/1RAB CRITICALITY | RAFJOHALE FOR SCREENS: A-FAIL, | | - | |
| 2536 | O | POMER CONDITIONER GIY. 1. SCHEMATICS 812798 815444 2559054 | MODE: LOSS OF MCPC PROTECTION. CAUSE(S): 1) POWER CONTROLLER RESISTORS FAIL OPEN. 2) POWER CONTROLLER DIODES FAIL OPEN. 3) RECTIFIER BOARD DIODES FAIL OPEN. | HONE LOSS OF MCIU. LOSS OF COMPUTER SUPPORTED MODES. REDUMDANT PATHS REMAINING FOR SAFING THE SYSTEM: 1) MCPC FAILURE DETECTION. 2) AUTOBRAKES. | FAILURE HIS | TORY | TATED WITH THIS FAILURE | , | |
| | | | | | | | | 1 20 | PAGE 470 OF 471 |

SO40237A ATTACHMENT -PAGE 471 OF 471

CRITICAL ITEMS LIST

PREPARED BY:

| FHEA FHEA | NAME, QTY, & | FAILURE HODE | FAFLURE EFFECT | MASS 4 F/N: 31(33F)BU-3 SHEET: |
|-----------|--|---|---|---|
| REF. REV. | DRAVING REF. DESIGNATION | AND CAUSE | CM END 11EM | HOWR / FUNC. RATIONALE FOR ACCEPTANCE 3/1RAB CRITICALITY SCREENS: A-FALL B-FALL C-PASS |
| 2536 O | POMER CONDITIONER QTY. 1. SCHEMATICS 812778 815444 2559054 | MODE: LOSS OF MCPC PROTECTION. CAUSE(S): 1) POWER CONTROLLER RESISTORS FAIL OPEN. 2) POWER CONTROLLER DIODES FAIL OPEN. 3) RECTIFIER BOARD DIODES FAIL OPEN. | MORST CASE LOSS OF MCIU. LOSS OF COMPUTER SUPPORTED MODES. REDUNDANT PATHS REMAINING \ FOR SAFING THE SYSTEM: 1) MCPC FAILURE DETECTION. 2) AUTOBRAKES. | OPERATIONAL EFFECT NONE BUT SUBSEQUENT FAILURE MAY CAUSE MCIU TO BE OVERSTRESSED. CREW ACTION NOME. CREW TRAINING CREW IS TRAINED: TO ALWAYS OBSERVE WHETHER THE ARM IS RESPONDING PROPERLY TO COMMANDS. IF IT ISN'T, APPLY BRAKES. TO RECOGNIZE AND RESPOND TO ALL OFF-HOMINAL OPERATIONS OF THE END EFFECTOR. MISSION CONSTRAINT NOME SCREEN FAILURES A: ENDEPENDENT REDUNDANT PATHS NOT INSTRUMENTED. B: NO ORBITER ANNUNCTATION OR DISPLAY. |
| | | | | OMRSD OFFLINE NONE CMRSD CHLINE INSTALLATION NONE OMRSD ONLINE TURNAROUND NONE |
| ED BY: MF | мс | SUPERCEDING DATE: | | ELEC - 227 |